


Gaviota Simbac

GAVIOTA SIMBAC, S.L.

Autovía de Levante, Km. 43

03630 **SAX** (Alicante) ESPAÑA / SPAIN

Tel. +34 965 474 200 • Fax +34 965 475 680

Export Dept.: +34 966 968 276 • Fax +34 966 968 075

comercial@gaviotasimbac.com - export@gaviotasimbac.com

www.gaviotasimbac.com


REF: 4004-363 · GAVIOTA SIMBAC, S.L. © FEBRERO 2008 · COPYRIGHT RESERVED

NOVEDAD

NEW PRODUCT

SOPORTE A1 PREMIUM / PREMIUM A1 SUPPORT


INSTRUCCIONES DE MONTAJE / ASSEMBLY INSTRUCTIONS

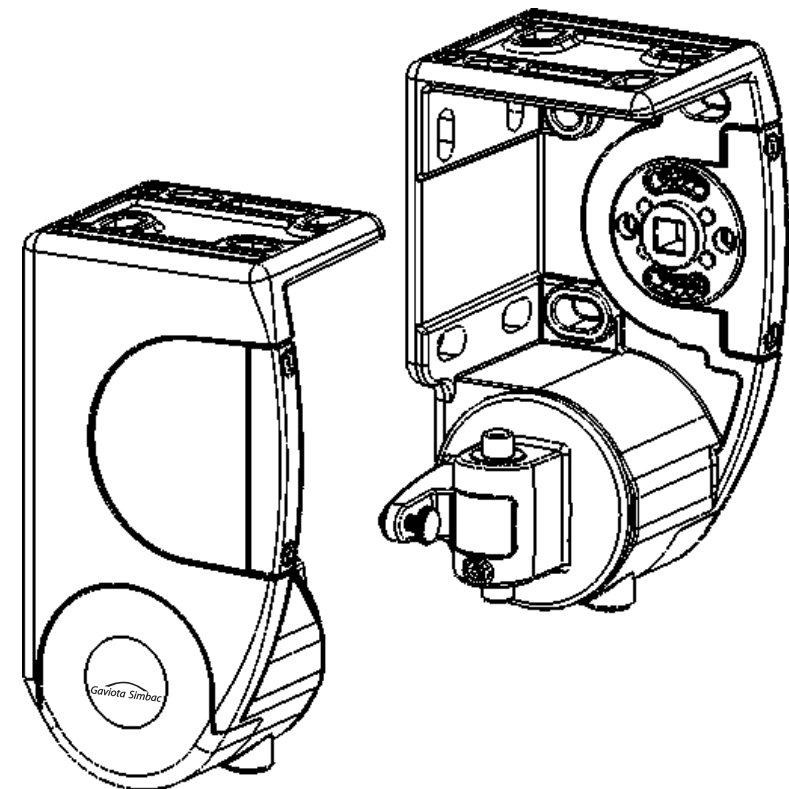

CÓDIGO/CODE	COLORES/COLORS
8008-1078.....	BLANCO / WHITE
8008-1079.....	PLATA / SILVER
8008-1080.....	NEGRO / BLACK
8008-1081.....	BRONCE / BRONZE
8008-1083.....	BURDEOS / DARK RED
8008-1084.....	VERDE / GREEN



Gaviota Simbac

Techo / Ceiling

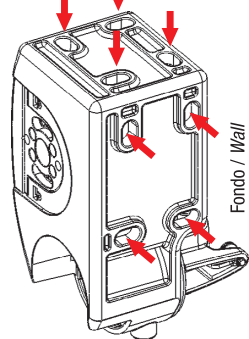


Fondo / Wall

1 Colocar soporte en posición (abrir taladros en posición lateral).
Place the support in the position to be fixed (open holes for screws in lateral position).

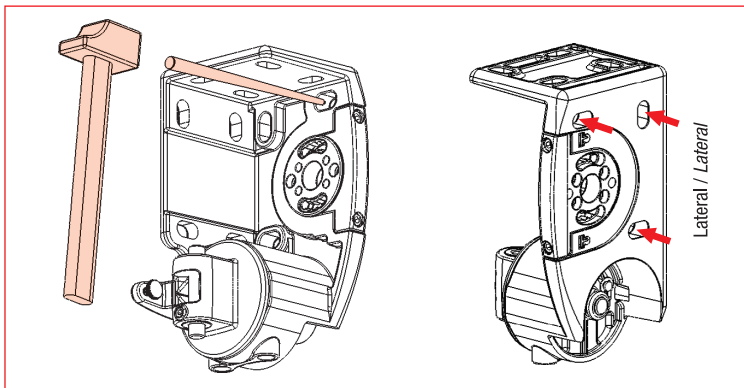

Lateral / Lateral


2 Preajuste tuerca central y aflojar a tope el prisionero trasero.
Presetting central nut and loosening the socket screw to its maximum position.

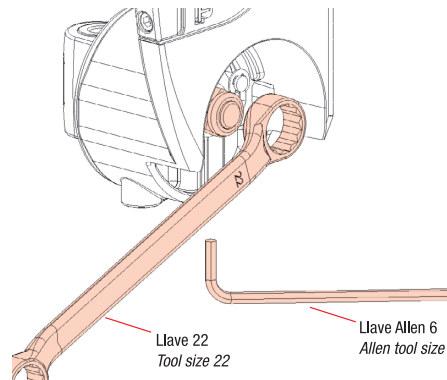


Llave 22
Tool size 22

Llave Allen 6
Allen tool size 6

Si procede, colocar la redonda de regulación en la posición más próxima a la inclinación deseada.
If necessary place the rounded arm support at the desired slope.

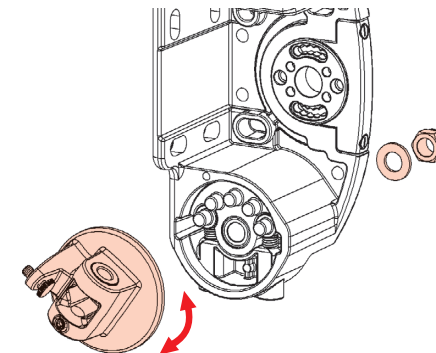


3 Acoplar brazo, centrar el eje en su orificio y fijarlo con el prisionero.
Fit the arm, locate the axle in its hole and fix it with the hexagon socket set screw.

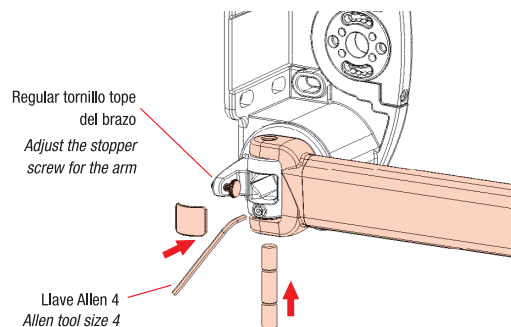

Regular tornillo tope del brazo
Adjust the stopper screw for the arm

Llave Allen 4
Allen tool size 4

4 Ajuste y bloqueo. / Tighten and block.

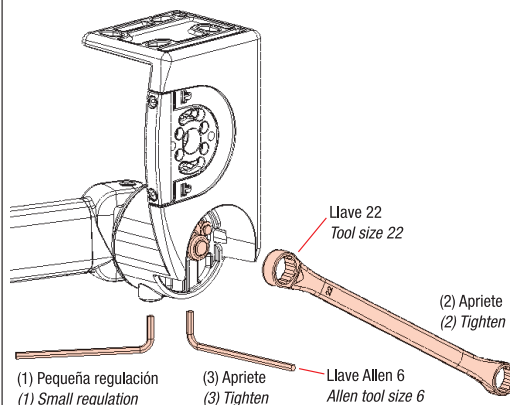

(1) Pequeña regulación
(1) Small regulation


(3) Apriete
(3) Tighten

Llave Allen 6
Allen tool size 6


(2) Apriete
(2) Tighten

5 Colocación de tapas.
Placing the external caps

(Apertura de tapas)
(Opening the caps)

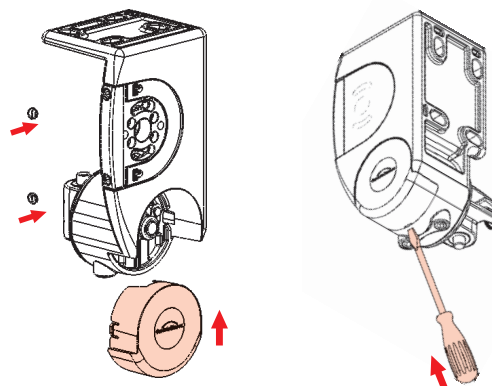


6a Instalación del motor.
Installing the tubular motor.

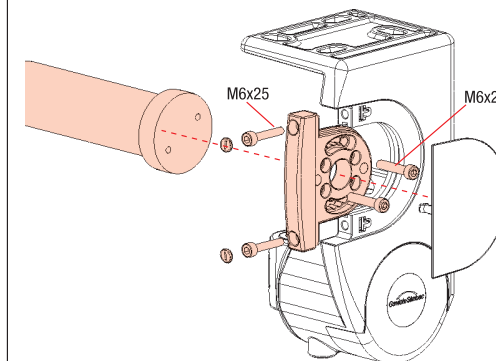

M6x25

M6x25


6b Instalación de máquina por interior.
Installing the gear in the inside.

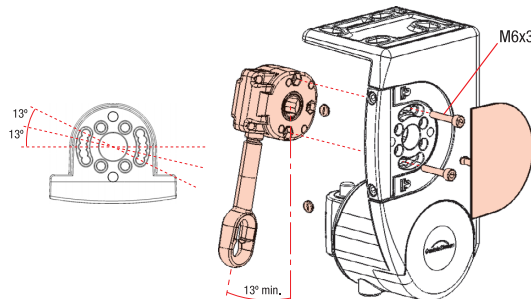

Nota: Máquina Ciclon pasante con tornillos M6x50 y con tuercas.
Máquina G8 con tornillos M6x40.

Note: Long screw Ciclon gear with M6x50 screws and nuts.
G-8 gear with M6x40 screws.

6c Instalación de máquina por exterior.
Installing the gear in the outside.

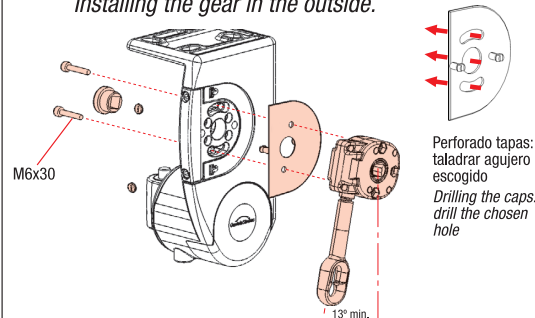


Perforado tapas: taladrar agujero escogido
Drilling the caps: drill the chosen hole

Nota: Máquina Ciclon pasante con tornillos M6x50 y con tuercas.
Máquina G8 con tornillos M6x40.

Note: Long screw Ciclon gear with M6x50 screws and nuts.
G-8 gear with M6x40 screws.


6d Suplemento máquina cáncamo corto para montaje en balcón.
Short eye gear adjustment for balcony use.

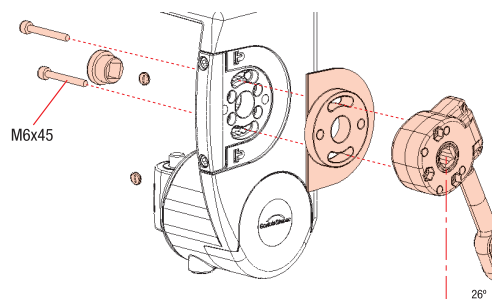

Nota: Máquina Ciclon pasante con tornillos M6x60 y con tuercas.
Máquina G8 con tornillos M6x60.

Note: Long screw Ciclon gear with M6x60 screws and nuts.
G-8 gear with M6x60 screws.

6d Instalación de casquillo.
Installing the cap.

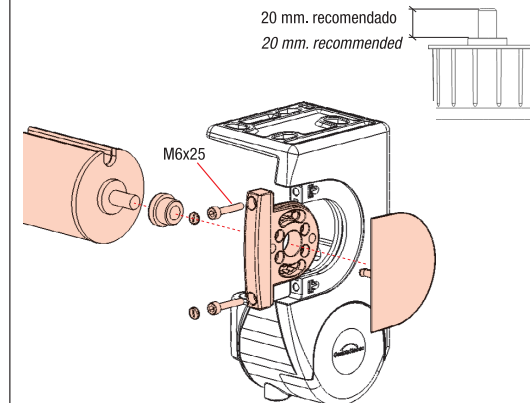

20 mm. recomendado
20 mm. recommended